

www.srithanaperfect.com

Consistent Supply for Consistent Production

Safety Data Sheet

Toluene

1. Identification of the substance or mixture and of the supplier

Trade Name : Toluene , Toluol

Material Uses : Raw material for use in the chemical industry.

Solvent for ink, paints, lacquers, resin,

adhesives, cleaning agent and mixed in fuel oil

Manufacturer : IRPC , Thailand

Supplier : Srithana Perfect Company Limited

440/4-6 Prachacheun Rd. Bangsue

Bangkok 10800 Thailand

Telephone: +66 2 913 7999 (Auto 20 Lines)

Fax: +66 2 586 0990-4

Website : www.srithanaperfect.com
E-mail : info@srithanaperfect.com

2. Hazards Identification

GHS Classification : Flammable liquids : Category 2

Reproductive toxicity :Category 2
Aspiration hazard : Category 1
Skin Irritation : Category 2

Specific target organ toxicity following single

exposure:Category 3

Specific target organ toxicity following

repeated exposure: Category 2

Signal word : Danger

Health Hazard : Harmful by inhalation. Risk of serious damage

to eye. Irritating to skin, eye and respiratory

system.

Environmental Hazard : Annex 2 substance under review by the EU

commission Toxic effect on fish and plankton.



www.srithanaperfect.com

Consistent Supply for Consistent Production

GHS Pictogram



GHS Hazard statements H225 Highly flammable liquid and vapour.

H361d Suspected of damaging the unborn child.

: H304 May be fatal if swallowed and enters airways.

H373 May cause damage to organs trough prolonged

or repeated exposure.

: H315 Causes skin Irritation.

H336 May cause drowsiness or dizziness.

GHS Precautionary statements

Prevention	P201	Obtain special instruction before use.
	P202	Do not handle until all safety precautions have been readand understood.
	P210	Keep away from heat/sparks/open flames/hot surface
	ar	nd Nonsmoking
	P233	Keep container tightly closed.
	P240	Ground/Bond container and receiving equipment.
	P241	Use explosion-proof
		electrical/ventilating/lighting/equipment.
	P242	Use only non-sparking tools.
	P243	Take precautionary measure against static discharge.
	P261	Do not breathe dust/fume/gas/mist/vapours/spray.
	P264	Wash thoroughly after handling.
	P271	Use only outdoors or in a well-ventilated area.
	P280	Wear protective glove/eye protection/face protection.
	P281	Use personal protective equipment as required.
D	ICl-i	

Response <u>If on skin</u>

P302+P352 Wash with plenty of soap and water.

P303+P361 Remove/Take off immediately all contaminated

clothing



www.srithanaperfect.com

Consistent Supply for Consistent Production

+P353 rinse skinwith water or shower.

P332+P313 Irritation occurs :Get medical advice/attention.

P362 Take off contaminated clothing and wash before reuse.

If swallowed

P301+P310 Immediately call a poison center or doctor/physician.

P331 Do not induce vomiting.

If inhaled

P304+P340 Remove victim to fresh air and keep at rest in a

position comfortable for breathing.

Storage P403+P233 Store in a well-ventilated place. Keep container tightly

P235 closed. Keep cool.

P405 Store locked up.

Disposal P501 Disposal should be in accordance with applicable

regional, national, and local laws and regulations. Local regulations may be more stringent than regional or national requirements and must be complied with.

Precautionary Pictograms













3. Composition/Information on ingredients

Chemical Name : Methyl-Benzene

Common Name : Toluene, Toluol

Synonyms Name : Phenyl Methane

CAS No. : 108-88-3

UN No. : 1294



www.srithanaperfect.com

Consistent Supply for Consistent Production

Molecular Weight : 92.13

Molecular Formula : C6H5CH3

4. First-aid measures

Inhalation : Remove to fresh air. If the victim has difficulty

breathing or tightness of the chest, give 100% oxygen

with rescue breathing or CPR as required and transport to the nearest medical facility.

Skin Contact : Remove contaminated clothing. Immediately flush

skin with large amounts of water for at least 15

minutes, and follow by washing with soap and water if

available.

Eye Contact : Immediately flush eyes with large amounts of water

for at least 10 minutes while holding eyelids open.

Transport to the nearest medical facility for additional

treatment.

Ingestion : Do not induce vomiting; Do not eat milk and castor oil,

transport to nearest medical facility for additional

treatment.

5. Fire -fighting measures

Suitable extinguishing media : Water spray or fog, Dry chemical

powder, Alcohol-resistant foam and Carbon dioxide.

Specific hazard arising from May produce toxic fumes of carbon monoxide, carbon

the chemical burning.

Special protective action for : Keep adjacent containers cool by spraying with water.

fire-fighters

Protective Equipment. Wear full protective clothing and self-contained

breathing apparatus.



www.srithanaperfect.com

Consistent Supply for Consistent Production

6. Accidental Release Measures

Protective Measures

- Observe all relevant local and international regulations.
- Avoid contact with spilled or released material. Immediately remove all contaminated clothing. For guidance on selection of personal protective equipment see chapter 8 this Material Safety Data Sheet. Shut off leaks, if possible without personal risks. Remove all possible sources of ignition in the surrounding area. Prevent from spreading or entering drains, ditches or rivers by using sand, earth, or other appropriate barriers.
- Take precautionary measures against static discharge. Ensure electrical continuity by bonding and grounding (earthing) all equipment.

Clean-Up Methods

Small spillage

(< 200 LT)

Transfer by mechanical means to a labeled, sealable container for product recovery or safe disposal. Allow residues to evaporate or soak up with an appropriate absorbent material and dispose of safely. Remove contaminated soil and dispose of safely.

• large spillage (> 200 LT)

Transfer by mechanical means such as vacuum truck to a salvage tank for recovery or safe disposal. Do not flush away residues with water. Retain as contaminated waste. Allow residues to evaporate or soak up with an appropriate absorbent material and dispose of safely. Remove contaminated soil and dispose of safely.



www.srithanaperfect.com

Consistent Supply for Consistent Production

Other Information : Notify authorities if any exposure to the general public

or the environment occurs or is likely to occur. Vapors may form explosive mixtures with air. Vapors may

travel to source of ignition and flash back.

7. Handling And Storage

Handling : Avoid contact with skin, eyes, and clothing. Do not

breathe vapours. Extinguish any naked flame. Remove ignition sources. Avoid sparks. Do not smoke. The

vapour is heavier than air spreads along the ground and distant ignition is possible. Ensure electrical

continuity by bonding and grounding

(earthing) all equipment. Do not use compressed air for filling, discharging, or handling operations. Handle and open container with care in well-ventilated area.

Do not empty into drains.

Storage : Must be stored in a diked (bunded) well-ventilated

area, away from sunlight, ignition sources and other sources of heat. Bulk storage tanks should be diked (bunded). Keep away from aerosols, flammables, oxidizing agents, corrosives. Storage Temperature:

Ambient.

Product Transfer : Keep containers closed when not in use. Do not use

compressed air for filling, discharging, or handling operations. If positive displacement pumps are used, these must be fitted with a nonintegral pressure relief valve. Ensure electrical continuity by bonding and

grounding (earthing) all equipment

Recommended Materials : For containers, or container linings use mild steel,

stainless steel.

Additional Advice : Containers even those that have been emptied, can

contain explosive vapours. Do not cut, drill, grind, weld or perform similar operations on or near containers.



www.srithanaperfect.com

Consistent Supply for Consistent Production

8. Exposure Controls and Personal Protection

Exposure Standard : Occupational Exposure Limits

• TLV-TWA = 100 ppm (375 mg/m³)

• TLV-STEL = 150 ppm (560 mg/m³)

Engineering Controls : Provide exhaust ventilation or other engineering

controls to Workplace keep the airborne concentrations of vapours below their respective threshold limit value.

Respiratory Protection : Vapor respirator. Be sure to use an approved/certified

respirator or equivalent. Wear appropriate respirator

when ventilation is inadequate.

Hand Protection Butyl rubber gloves, Nature rubber gloves, Neoprene

rubber gloves, Nitrile rubber gloves.

Eye Protection : Chemical splash goggles (chemical monogoggles).

Other Protection : Use protective clothing which is chemical resistant to

this material. Safety shoes and boots should also be

chemical resistant

9. Physical and Chemical Properties

Appearance : Clear liquid.

Odour : Specially odour.

Purity : Toluene 99.0%

pH Value : No data available.

Boiling Point (oC) : 110.6 °C

Melting Point (oC) : -95 °C

Flash Point : $4 \,{}^{\circ}\text{C} \,(\text{Abel})$

Evaporating Rate : 2 (n-Butyl Acetate = 1)

Lower/Upper Flammability : 1.2 - 7.1 %V



www.srithanaperfect.com

Consistent Supply for Consistent Production

limits

Vapour Pressure (mmHg) : 22 mmHg @ 20 °C

Specific Gravity : 0.868 @ 20 °C (ASTM D4052)

Density (g/cm3) : 0.867 - 0.869 @ 20 °C (ASTM D4052)

Vapour Density : 3.2 @ 20 °C (air = 1)

Solubility in Water : Slightly dissolve @ $20 \, ^{\circ}\text{C} \, (515 \, \text{g/m}3)$

Auto Ignition Temperature : 535 °C

10. Stability and Reactivity

Chemical Reactivity : Stable under normal conditions

Stability : Stable under normal conditions.

Hazardous Polymerisation : No.

Conditions to Avoid Heat, flame, spark and other ignition sources.

Materials to Avoid : Strong oxidizing agents.

Hazardous Decomposition : Thermal decomposition is highly dependent on

conditions. Products Carbon monoxide, carbon

dioxide and other organic compounds will be evolved when this material undergoes combustion or thermal

or oxidative degradation. May form explosive

peroxides.

11. Toxicological Information

Acute Toxicity

LD50 Acute oral toxicity : 636 mg/kg , (rat)
 LD50 Acute dermal : 14,100 ul/kg , (rabbit)

_ 1,_00 (11,116)

toxicity

• LC50 Acute Inhalation : 49 g/m³/₄ hours , (rat)



www.srithanaperfect.com

Consistent Supply for Consistent Production

Toxicity

Skin Irritation : Irritating to skin. Prolonged/repeated contact may

cause defatting of the skin which can lead to

dermatitis.

Eye Irritation : Irritating to eyes.

Respiratory Irritation : Inhalation of vapours or mists may cause irritation to

the respiratory system.

12. Ecological Information

Acute Toxicity

Fish : Low toxicity : LC50 70 mg/l
 Aquatic Invertebrates : Low toxicity : EC50 270 mg/l

Mobility : Slightly dissolves in water.

If product enters soil, it will highly mobile and may

contaminate groundwater.

Persistence / Degradability : Readily biodegradable.

Bio-accumulation : Not expected to bioaccumulate significantly

13. Disposal Considerations

Material Disposal : Recover or recycle if possible. It is the responsibility of

the waste generator to determine the toxicity and physical properties of the material generated to determine the proper waste classifications and disposal methods in compliance with applicable

regulations.

Container Disposal : Drain container thoroughly. After draining, vent in a

safe place away from sparks and fire. Refer to Section 7 before handling the product or containers. Residues may cause an explosion hazard. Do not puncture, cut or



www.srithanaperfect.com

Consistent Supply for Consistent Production

weld unclenaed drums. Send to drum recoverer or metal reclaimer.

Local Legislation : Disposal should be in accordance with applicable

regional, national, and local laws and regulations. Local regulations may be more stringent than regional or national requirements and must be complied with.

14. Transport Information

Road/Rail Transport

ADR/RID

UN. Number : 1294Class/Item : 3/3(b)

• Hazard Symbol : Flammable Liquid

Proper Shipping Name : Toluene

• Packing Group : II

Maritime Transport IMO

UN. Number : 1294
 Class : 3.2
 Packing Group : II

Hazard Symbol : Flammable Liquid

• Proper Shipping Name : Toluene

Marine Pollutant : No

Air Transport IATA/ICAO

• UN. Number : 1294

• Class : 3

• Packing Group : II

• Hazard Symbol : Flammable Liquid



www.srithanaperfect.com

Consistent Supply for Consistent Production

Proper Shipping Name
 Toluene

15. Regulatory Information

EC Label Name : Toluene

EC Classification : Highly Flammable , Harmful


EINECS (EC) : 203-625-9

EC Annex I Number : 601-021-00-3

MITI (Japan) : 3-2

16. Other Information

National Fire Protection Association (USA)

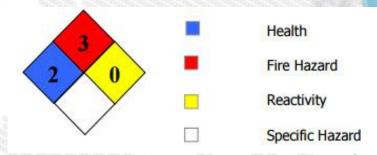

MSDS Distribution : The information in this document should be made

available to all who may handle the product.

Prepared By : Quality Control Department.

Srithana Perfect Company Limited

Disclaimer:

The information contained herein is based on our current knowledge of the underlying data and is intended to describe the product for the purpose of health, safety and environmental requirements only. No warranty of guarantee is expressed or implied regarding the accuracy of these data or the results to be obtained from the use of the product.